


HTC Maple 100 LCD Screen Replacement

This guide will help you install an LCD screen.

Written By: Nick

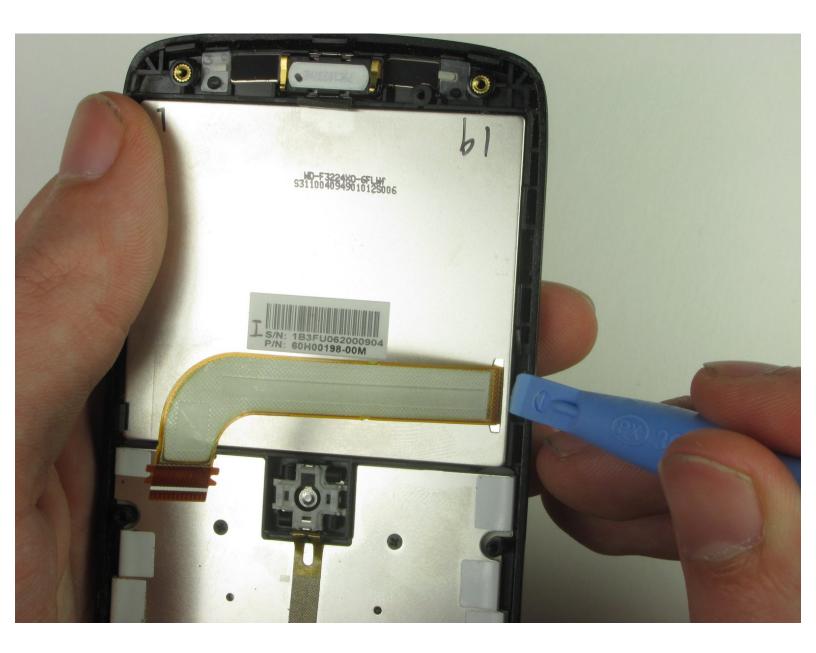

INTRODUCTION

Be careful with the LCD screen. It is fragile.



TOOLS:

- Phillips #00 Screwdriver (1)
- iFixit Opening Tools (1)
- T6 Torx Screwdriver (1)

Step 1 — Battery



 First remove the back cover of your phone to expose the battery.

Step 2



- Turn the phone over.
- Push forward on the battery with your thumb.





- Take the battery out by lifting it upwards.
- Mhen reassembling, make sure that the battery contacts match up.

Step 4 — Back Panel





Remove the four 4.9mm T6 Torx screws that secure the back panel to the rest of the phone.



 Remove the two 4.3mm Phillips #00 screws that secure the back panel to the rest of the phone.

Step 6








- Insert the plastic opening tool along the seams at different points to it pry the clips off.
- i This may require a bit of force. The USB port cover may fall off in this step.

Step 7 — **Motherboard**



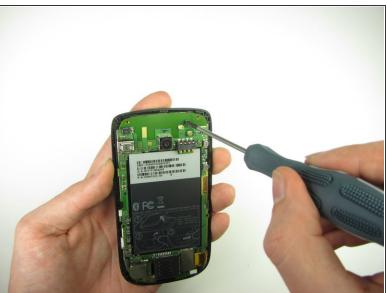

Remove the one 3.3mm Phillips #00 screw.


Step 8






Use your finger or the plastic opening tool to unclip the board.

♠ Be aware of the ribbon cable connected to the motherboard inside the phone.

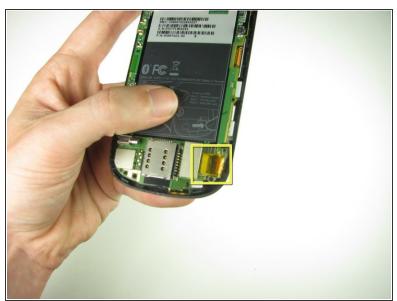

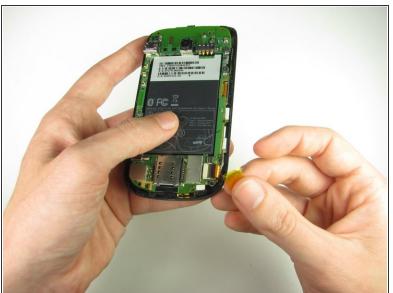


Peel off the yellow piece of tape from the phone.

Step 10





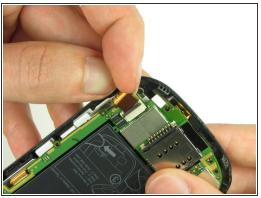


- Flip up the retaining flap with your fingernail or a plastic opening tool.
- Pull on the ribbon cable gently with your fingers.






- Split apart the motherboard and front panel.
- Remove the other yellow piece of tape off of the end of the ribbon cable.


Step 12

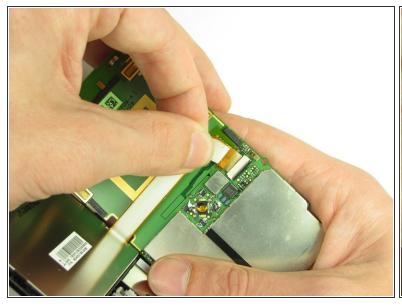

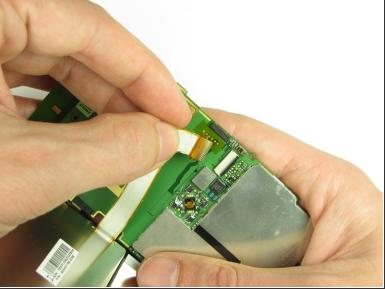

Gently pull on the ribbon cable to separate the motherboard.

Step 13 — LCD Screen

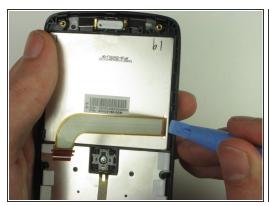





Pry the LCD screen out by using the plastic opening tool or your fingers.

To reassemble your device, follow these instructions in reverse order.