



Samsung Galaxy Tab A 7.0" Headphone Jack Replacement

Replace faulty headphone jack to your Samsung Galaxy Tab A 7.0"

Written By: Bradley Watson





TOOLS:

- [iFixit Opening Tools](#) (1)
- [Tweezers](#) (1)
- [Phillips #0 Screwdriver](#) (1)



PARTS:


- [Galaxy Tab A 7.0 Headphone Jack Assembly](#) (1)

Step 1 — Headphone Jack




- Using the plastic opening tool, starting at any corner on the tablet, insert the tool between the back panel and the front panel.
- Slide tool around the tablet to unlock the panels from one another.

Step 2

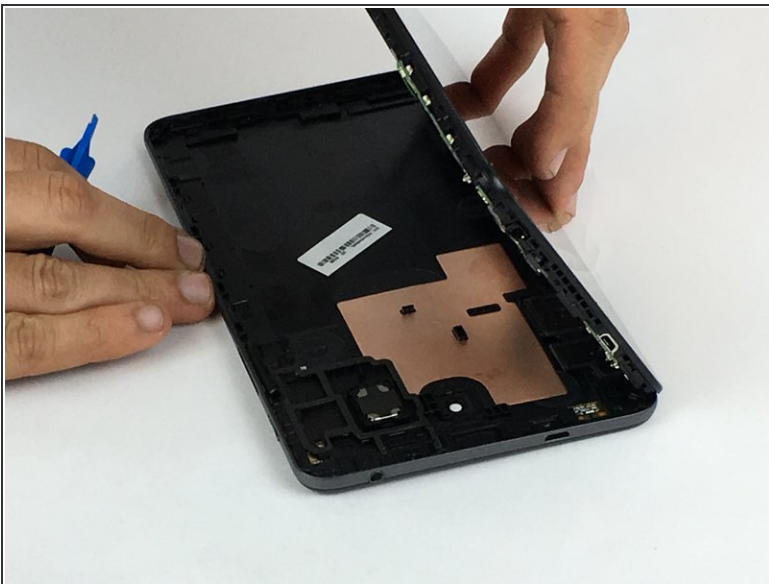


- Carefully remove the back panel from the front panel.
- The inner components of the tablet will now be exposed.

Step 3

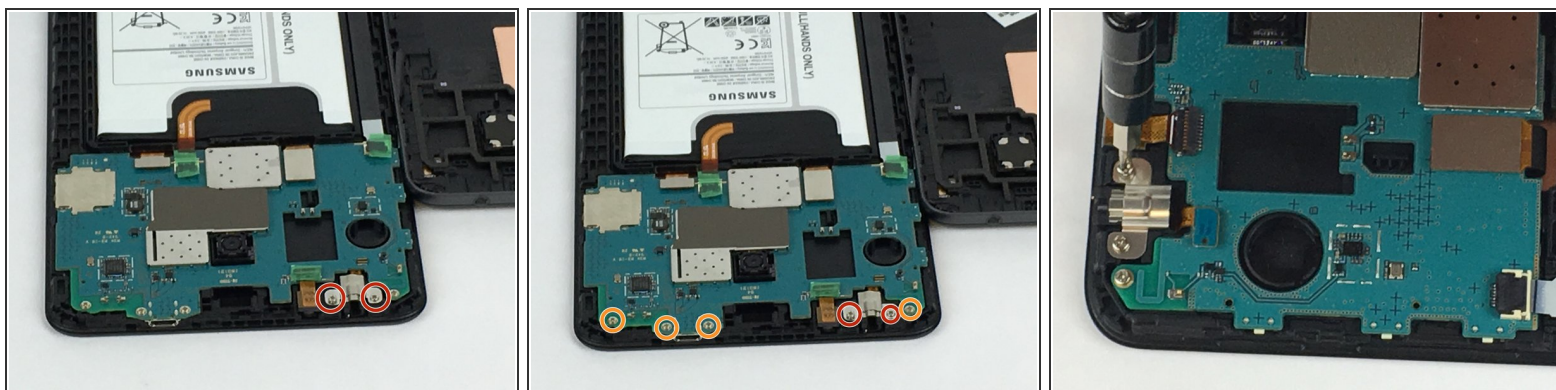


- Remove the two Phillips head screws attaching the auxiliary port to the plastic frame using a P000 screwdriver.
- Remove the four Phillips head screws attaching the motherboard to the plastic case using a P000 screwdriver.

Step 4

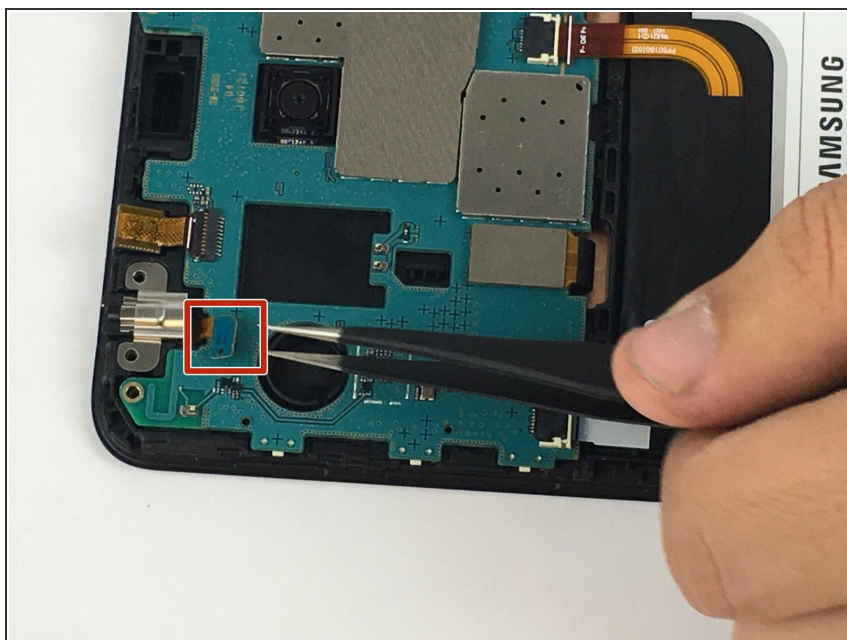


- Using tweezers disconnect the headphone jack connector from the motherboard.

Step 5

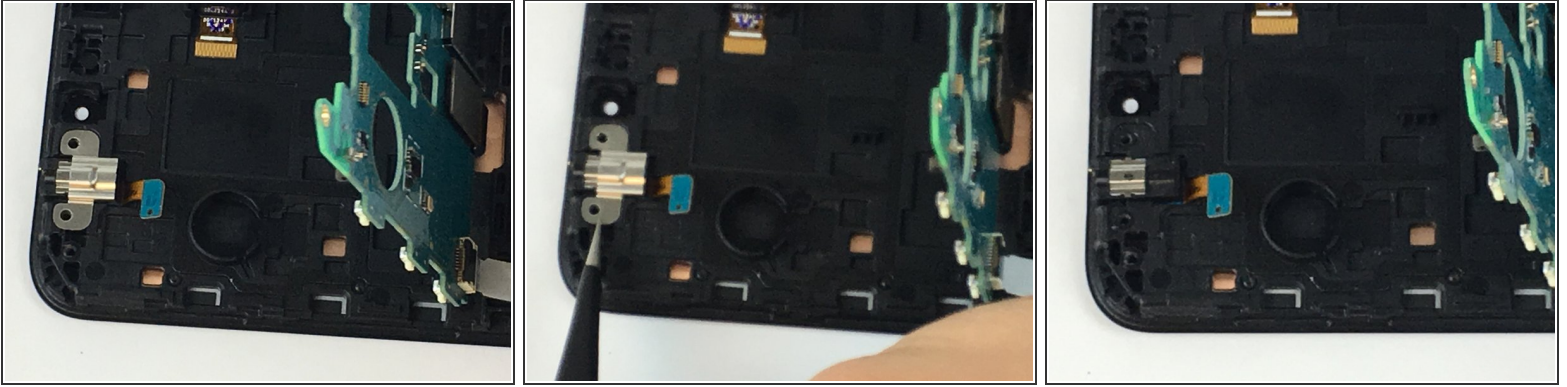

- Using tweezers, carefully lift up the motherboard.
- Using tweezers, remove the metal jacket holding the headphone jack in place by grabbing the left corner where there is a recess to grab it.
- ⓘ There is a light adhesive holding the metal jacket down. You may have to pull slightly harder to get this off.

Step 6

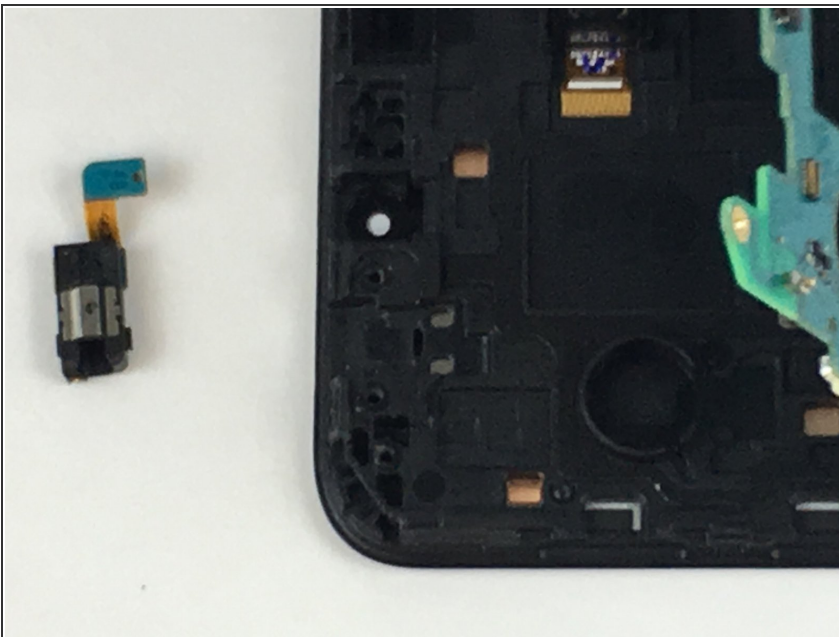

- Remove the auxiliary port from the case.

To reassemble your device, follow these instructions in reverse order.

This document was generated on 2020-11-22 04:30:44 AM (MST).

